


①

USAARL Report No. 93-27


AD-A270 946

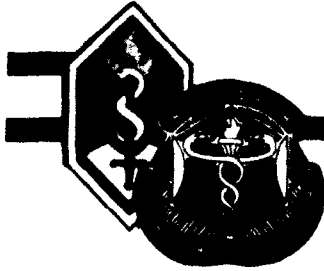

**Analysis of Injury Severity
Caused by Flight Motor Overpressure
of the Javelin Antiarmor Missile**

By

James E. Bruckart

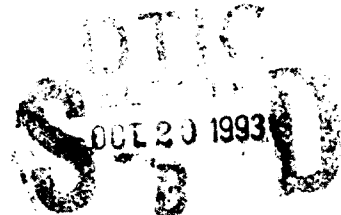

Impact, Tolerance, and Protection Division

July 1993

93-24703



93 10 18 001

Approved for public release; distribution unlimited.

**United States Army Aeromedical Research Laboratory
Fort Rucker, Alabama 36362-5292**

Notice

Qualified requesters

Qualified requesters may obtain copies from the Defense Technical Information Center (DTIC), Cameron Station, Alexandria, Virginia 22314. Orders will be expedited if placed through the librarian or other person designated to request documents from DTIC.

Change of address

Organizations receiving reports from the U.S. Army Aeromedical Research Laboratory on automatic mailing lists should confirm correct address when corresponding about laboratory reports.

Disposition

Destroy this document when it is no longer needed. Do not return it to the originator.

Disclaimer

The views, opinions, and/or findings contained in this report are those of the author(s) and should not be construed as an official Department of the Army position, policy, or decision, unless so designated by other official documentation. Citation of trade names in this report does not constitute an official Department of the Army endorsement or approval of the use of such commercial items.

Reviewed:



JOHN V. BARSON
LTC, MC, SFS
Director, Impact, Tolerance,
and Protection Division

Released for publication:



ROGER W. WILEY, O.D., Ph.D.
Chairman, Scientific
Review Committee



DAVID H. KARNEY
Colonel, MC, SFS
Commanding

REPORT DOCUMENTATION PAGE				Form Approved OMB No 0704 0188	
1a REPORT SECURITY CLASSIFICATION Unclassified		1b RESTRICTIVE MARKINGS			
2a SECURITY CLASSIFICATION AUTHORITY		3 DISTRIBUTION AVAILABILITY OF REPORT Approved for public release, distribution unlimited			
2b DECLASSIFICATION/DOWNGRADING SCHEDULE					
4 PERFORMING ORGANIZATION REPORT NUMBER(S) USAARI Report No. 93-27		5 MONITORING ORGANIZATION REPORT NUMBER(S)			
6a NAME OF PERFORMING ORGANIZATION U.S. Army Aeromedical Research Laboratory		6b OFFICE SYMBOL (if applicable) SGRD-UAD-IE	7a NAME OF MONITORING ORGANIZATION U.S. Army Medical Research and Development Command		
6c ADDRESS (City, State, and ZIP Code) P.O. Box 620577 Fort Rucker, AL 36362-0577		7b ADDRESS (City, State, and ZIP Code) Fort Detrick Frederick, MD 21702-5012			
8a NAME OF FUNDING/SPONSORING ORGANIZATION		8b OFFICE SYMBOL (if applicable)	9 PROCUREMENT INSTRUMENT IDENTIFICATION NUMBER		
8c ADDRESS (City, State, and ZIP Code)		10 SOURCE OF FUNDING NUMBERS			
		PROGRAM ELEMENT NO 0602787A	PROJECT NO 3M162787A8	TASK NO. 8 AG	WORK UNIT ACCESSION NO 138
11 TITLE (Include Security Classification) Analysis of Injury Severity Caused by Flight Motor Overpressure of the Javelin Antiarmor Missile					
12 PERSONAL AUTHOR(S) James E. Bruckart					
13a TYPE OF REPORT Final		13b TIME COVERED FROM _____ TO _____	14 DATE OF REPORT (Year, Month, Day) 1993 July	15 PAGE COUNT 14	
16 SUPPLEMENTARY NOTATION					
17 COSATI CODES			18 SUBJECT TERMS (Continue on reverse if necessary and identify by block number)		
FIELD	GROUP	SUB-GROUP			
19	09		Javelin, missile, overpressure, injury, blast		
19	06				
19 ABSTRACT (Continue on reverse if necessary and identify by block number)					
<p>The Javelin is an antiarmor missile system designed to replace the Dragon. A rare malfunction of the missile involves overpressure of the flight motor. Data on the number, mass, and velocity of large debris items were determined by simulation of the malfunction. This report reviews the severity of injuries to the gunner or assistant gunner expected from a malfunction.</p> <p>The probability of being struck by a missile fragment was calculated as 96 in 100. The most severe injuries include a head or groin injury from either of the two largest debris items or an eye injury from any debris fragment. Other possible injuries include upper extremity fractures or superficial lacerations. Specific steps to reduce the hazard and improve personal protection will reduce the severity of injuries.</p>					
20 DISTRIBUTION/AVAILABILITY OF ABSTRACT <input checked="" type="checkbox"/> UNCLASSIFIED/UNLIMITED <input type="checkbox"/> SAME AS RPT <input type="checkbox"/> DTIC USERS			21 ABSTRACT SECURITY CLASSIFICATION Unclassified		
22a NAME OF RESPONSIBLE INDIVIDUAL Chief, Scientific Information Center		22b TELEPHONE (Include Area Code) 205-255-6907	22c OFFICE SYMBOL SGRD-UAX-SI		

Table of contents

	Page
List of figures	2
List of tables	2
Introduction	3
Materials and methods	8
Results	10
Discussion	11
Conclusions	13
References	14

Accession For	
NTIS GPO&I	<input checked="" type="checkbox"/>
NTIS DR	<input type="checkbox"/>
Unannounced	<input type="checkbox"/>
For information	
By	
Distribution/	
Availability Codes	
Full	
Dist	Special
A-1	

List of figures

Figure	Page
1. Javelin missile configuration	3
2. Missile battery	5
3. Launch motor housing	5
4. CAS motor	6
5. Control fin	6
6. TVC vane	7
7. Schematic showing standing position for gunner, assistant gunner (exact duty position not yet decided), and missile at time of malfunction	9

List of tables

Table	Page
1. Estimated system weights	3
2. Rearward velocity of overpressure debris	4
3. Calculated frontal surface area	10
4. Probability of being struck by a specific large debris item or any large debris item	11
5. Kinetic energy of large debris items	11

Introduction

The Javelin is a man-portable, shoulder-launched, antiarmor weapon system for attacking and destroying armored tank targets. It will replace the Dragon, the current antitank weapon. The Javelin system features reduced blast signature, fire and forget targeting, and twice the range of the Dragon.

The Javelin system consists of a command launch unit (CLU) and missile round. The CLU includes a sight system for surveillance, target identification, and target lockon. The missile round consists of the launch tube assembly, battery/coolant unit, and missile. The missile is shown in Figure 1. The battery/coolant unit supplies electrical power to initiate launch and cooling gas to precool the missile seeker before launch. Estimated system weights are presented in Table 1 (Texas Instruments, 1992).

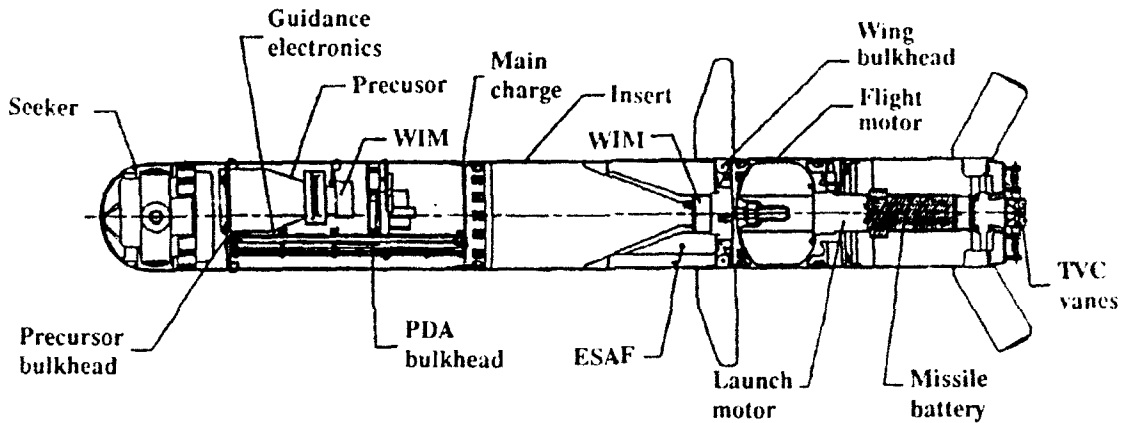


Figure 1. Javelin missile configuration.

Table 1.
Estimated system weights.

Component	Weight (kg)	Weight (lbs)
Command launch unit	6.38	14.07
Launcher	4.15	9.16
Missile	11.78	25.98

The missile system is operated by a gunner and assistant gunner. When firing the missile, both soldiers will wear the Personnel Armor System for Ground Troops (PASGT) helmet, battle dress uniform (BDU), and Kevlar® protective vest. The gunner will be positioned behind the missile with his face protected by the face shield of the command launch unit. The position of the assistant gunner has not been decided.

A rare malfunction of the Javelin missile involves in-flight overpressure of the flight motor shortly after ejection of the missile from the launch tube. This malfunction produces debris that may pose a hazard to the gunner or assistant gunner. In conjunction with the Javelin test program, the malfunction was simulated in three tests by plugging the nozzle of the flight motor on a test missile. The test articles included inert launch motors and live flight motors. For each test, high-speed cameras and debris panels were placed around the missile. This generated information on the likely debris items, scatter pattern, and velocity.

The simulated malfunction produces several small debris items including pieces of circuit board and composite materials with low mass. The large debris items include the (a) missile battery, (b) launch motor housing, (c) CAS motors [4 each], (d) control fins [4 each], and (e) TVC vane [4 each]. These items are shown in Figures 2-6 and the rearward velocity from a simulated malfunction (25 January 1993) is shown in Table 2.

Table 2.

Rearward velocity of overpressure debris*.

Debris item	Velocity (m/s)	Velocity (fps)
Missile battery	19.1	62.8
Launch motor housing	17.0	55.9
CAS motor (#1)	24.0	78.6
CAS motor (#2)	18.1	59.4
CAS motor (#3)	18.1	59.4
CAS motor (#3)	17.2	56.3
Control fin (#1)	34.6	113.6
TVC vane (#1)	22.6	74.2
TVC vane (#2)		

* Debris velocity calculated by subtracting nominal missile velocity (44 fps) from debris velocity 4 feet behind the missile in a static test.

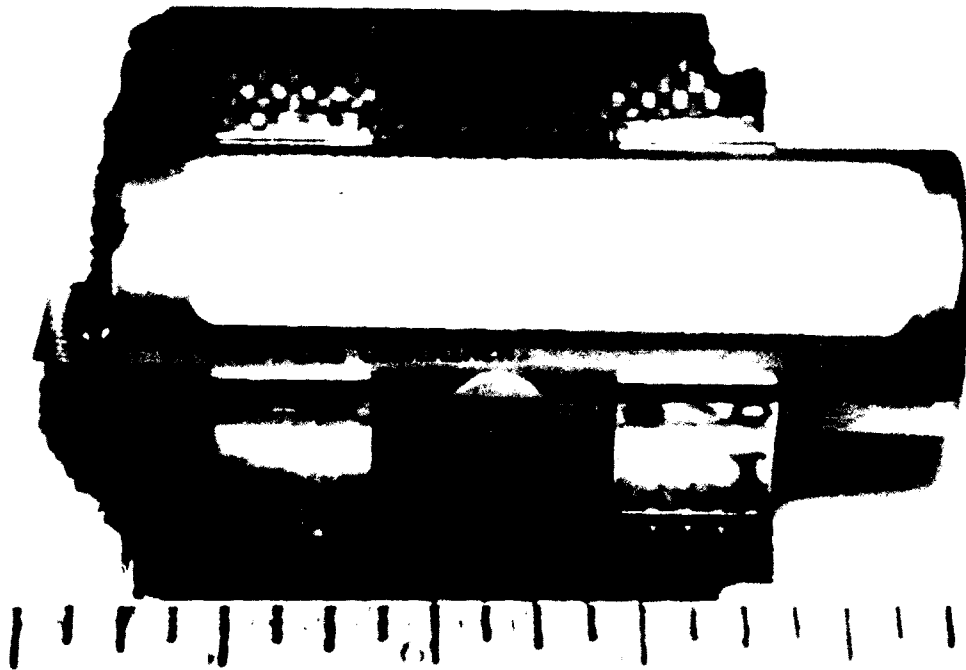


Figure 2. Missile battery.

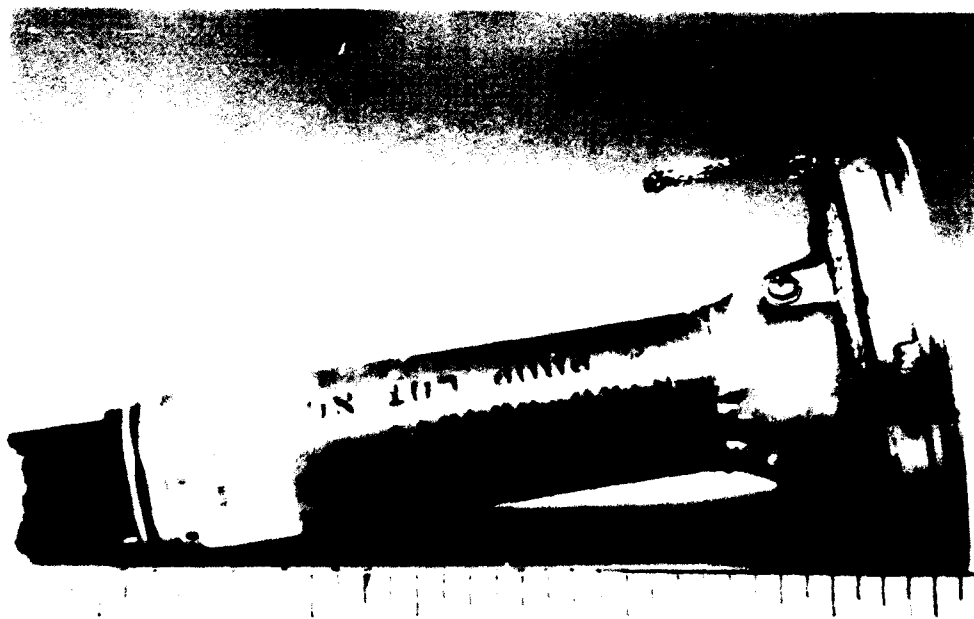


Figure 3. Launch motor housing.

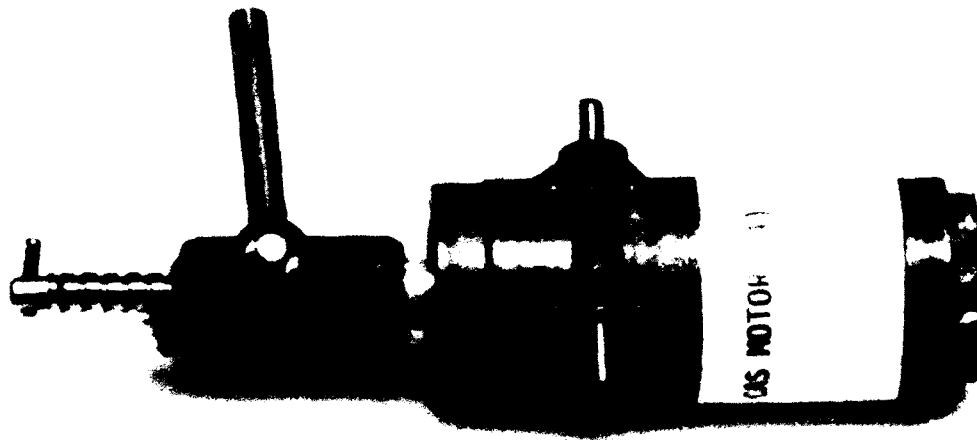


Figure 4. CAS motor.

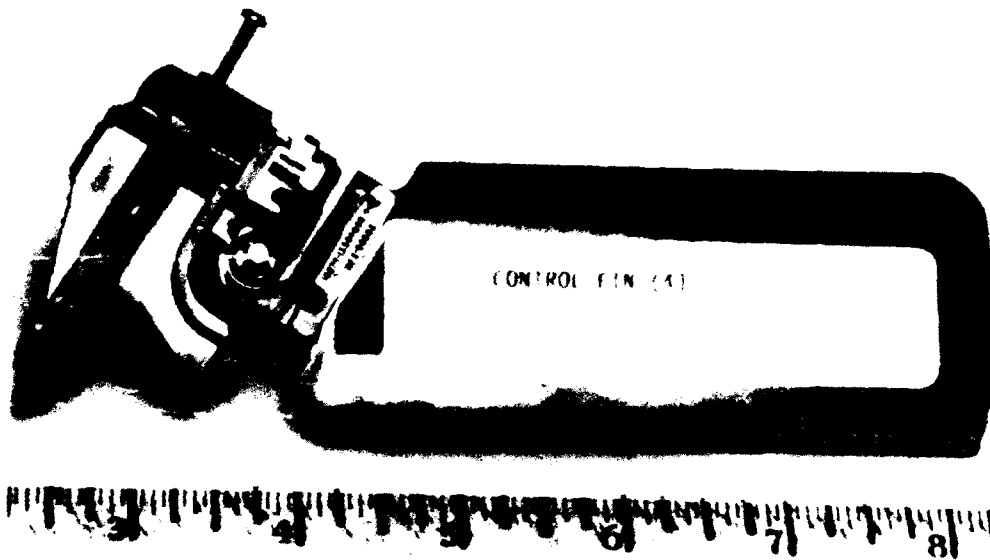


Figure 5. Control fin.

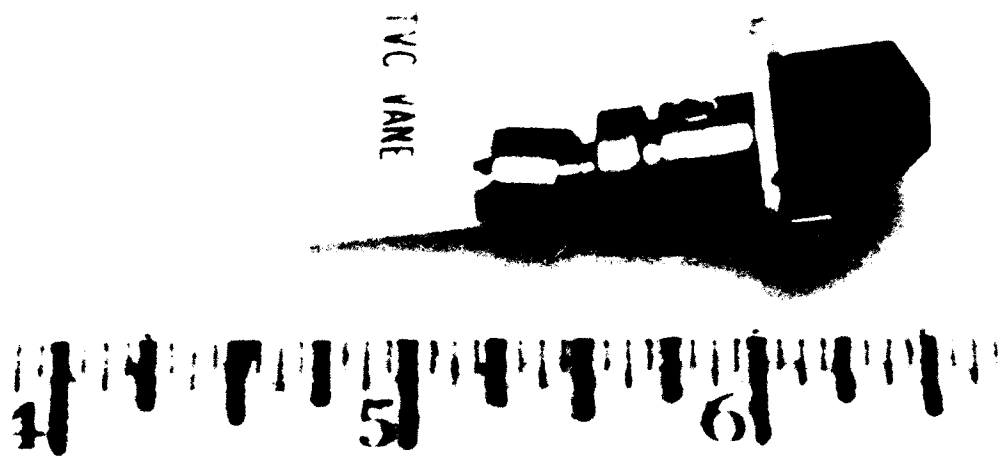


Figure 6. TVC vane.

The purpose of this paper is to discuss the type and severity of injuries that would occur to the gunner and assistant gunner from in-flight overpressure of the missile. The System Safety Working Group of the Javelin program office requested this information to support the hazard assessment of an overpressure malfunction, in accordance with MIL-STD 882D (Department of Defense, 1984).

Materials and methods

Probability of debris strike

Javelin missile test firings showed the flight motor ignites 0.4 seconds after the missile is launched. At that time the missile was 1.5 meters above the ground, 4.6 m (15 feet) down range, and had achieved a forward velocity of 13.4 m/s (44 fps). Figure 7 shows the relative distance between the gunner, assistant gunner (possible position), and missile at the time of malfunction. The position of the assistant gunner during missile launch has not been decided, but it should not be closer to the missile than the gunner.

Malfunction simulations show only a small probability that the gunner will be struck by a piece of debris. In these tests, the launch motor and battery have gone to the right and left side of the gunner position, respectively. If the debris spreads randomly within a cone shaped area behind the missile (60 degrees wide by 60 degrees elevation), most debris items will strike the ground or miss the soldiers. The probability that a piece of debris will strike a soldier is estimated by dividing the surface area of the soldier by the surface area of the 15-foot (4.6 m) radius sphere contained within the impact cone. The probability of being struck by at least one large piece of debris is the sum of the probabilities for each single piece of debris.

The frontal surface area of a prone, kneeling (or sitting), and standing soldier was calculated for the 95th percentile male soldier using the data collected by Gordon et al. (1989). The calculated surface areas are shown in Table 3.

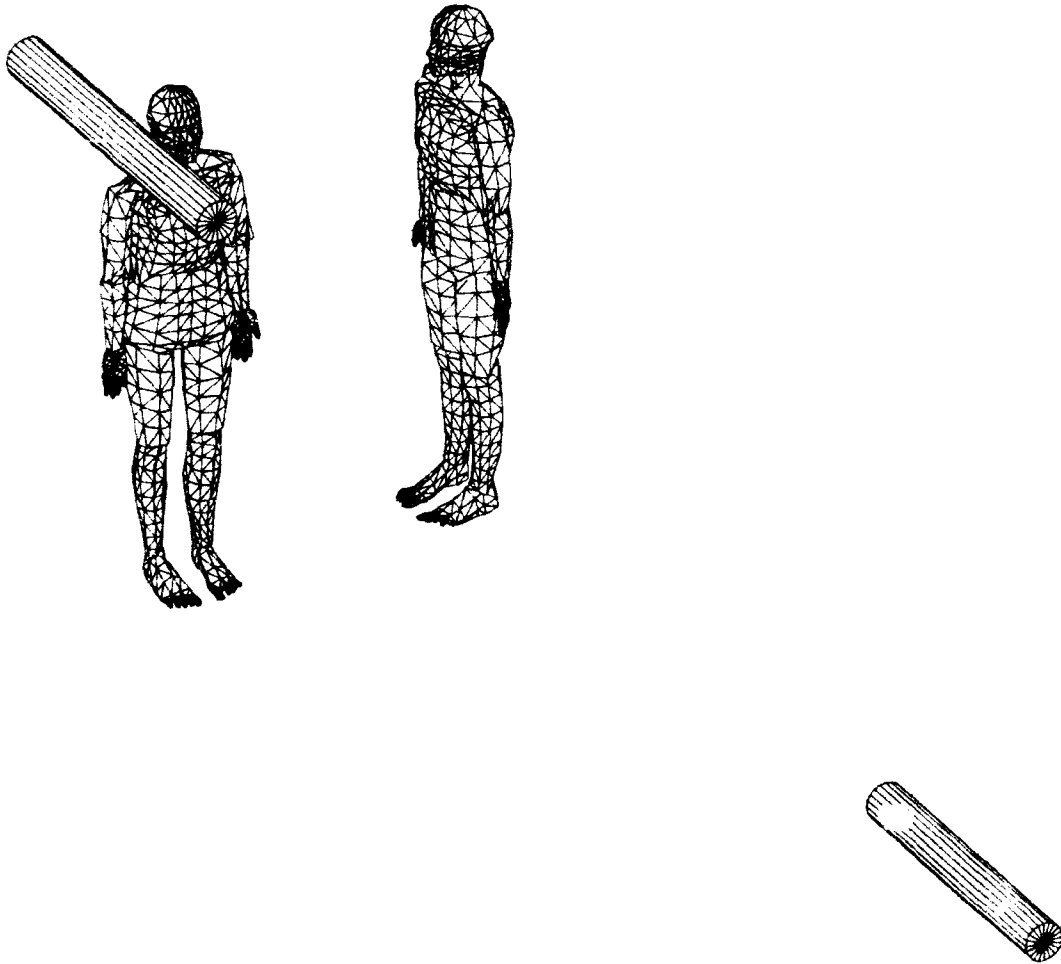


Figure 7. Schematic showing standing position for gunner, assistant gunner (exact duty position not yet decided), and missile at time of malfunction.

Table 3.

Calculated frontal surface area.

Position	Method	Surface area (sq cm)
Prone	Chest depth x bilateral breadth	1500
Kneeling/sitting	Chest height x bilateral breadth	7326
Standing (face to missile)	Stature x bilateral breadth	9982
Standing (side to missile)	Stature x chest depth	5234

Calculation of debris impact energy

Debris items that strike the gunner or assistant gunner can produce injury. The impact energy for debris that strikes the body (and does not deflect off or pass through the body) is equal to the kinetic energy of the item. The kinetic energy for each debris item is half the mass times the square of the velocity.

Results

Given a homogeneous scatter of debris in the area behind the missile malfunction, the worst case probability of being struck by a large debris item is 96 in 100. The probability of being struck by debris decreases as the surface area exposed to the blast decreases. A calculated strike probability for each position is shown in Table 4. The probability of any debris strike causing injury is small.

The kinetic energy for each debris item recovered from a malfunction simulation is presented in Table 5.

Table 4.

Probability of being struck by a specific large debris item or any large debris item.

Position	Single item (N=1)	Any item (N=14)
Prone	0.010	0.144
Kneeling or sitting	0.050	0.703
Standing (face to missile)	0.068	0.958
Standing (side to missile)	0.036	0.502

Table 5.

Kinetic energy of large debris items.

Debris item	Mass (g)	Kinetic energy (J)
Missile battery	376	68.5
Launch motor housing	825	119.2
CAS motor (#1)	130	37.4
CAS motor (#2)	130	21.2
CAS motor (#3)	130	21.2
Control fin (#1)	64	9.5
TVC vane (#1)	19	11.1
TVC vane (#2)	19	4.75

Discussion

The method used to calculate the probability of being struck by debris assumes that each fragment is randomly expelled through the strike area. Data on the actual scatter pattern for each fragment will provide a more accurate estimate of which debris items will strike the gunner or assistant gunner.

The injury produced by a projectile is related to the shape of the projectile, type of tissue struck by the projectile, and energy deposited in the tissue (Fackler, 1987; Mendelson, 1991). The kinetic energy of the projectile is a measure of the energy that must be absorbed by the tissue to stop the movement of the object. For example, the kinetic energy of a baseball thrown at 70 miles per hour is 73 J and the kinetic energy of a 55 grain bullet fired by an M-16 (988 m/s) is 945 J (Grolier, 1992; Barach, Tommlanovich, and Nowak, 1986).

The most severe credible injury that will occur with an overpressure malfunction is an eye injury. A large debris item can pierce the eye and even small fragments from a circuit board or composite casing can lacerate the cornea. The worst credible eye injury would be critical (category II) in severity. Since the gunner's face is protected by the command launch unit, only the assistant gunner is exposed to this hazard and only if he is looking at the missile when it malfunctions. This injury can be prevented by using safety devices (goggles or a face shield) to protect the assistant gunner, or with procedures or training that prevent him from looking at the missile early in flight.

The two largest items of debris (launch motor housing and missile battery) may have sufficient impact energy to cause significant injury. If the launch motor housing or battery strikes the PASGT helmet, it can transmit sufficient energy to cause a closed head injury. This injury will produce several minutes of unconsciousness and, rarely, seizures. In addition, the same items will cause significant tissue damage if they strike the unprotected groin. These are both considered critical (category II) injuries. The head injury hazard can be reduced by adding impact attenuation characteristics (such as an energy-absorbing liner) to the PASGT helmet. The groin injury could be prevented with strike protection.

Other credible injuries from these two items include deep tissue bruising and fractures if the debris strikes the unprotected hand or forearm. There will be deep bruising in the lower extremities, but fractures are unlikely. These injuries are considered marginal (category III) in severity.

The remaining debris items have less kinetic energy and are not expected to produce the closed head injury, significant groin injury, or fractures possible with the launch motor housing or missile battery. They will cause some tissue bruising and the irregular and sharp surfaces on these debris items will penetrate the BDU and cause lacerations. These injuries are considered marginal (category III) in severity.

Conclusions

Random dispersion of debris from an overpressure malfunction poses only a small risk that the gunner or assistant gunner will be injured. The worst credible injuries include eye injury, closed head injury, and blunt trauma to the groin. Eye injuries can be reduced by adding eye protection for the assistant gunner. The head injury and groin injury hazard will be eliminated if the launch motor housing and battery can be prevented from striking the gunner or assistant gunner. Other approaches include the addition of an energy-attenuating liner in the PASGT helmet and protection of the groin. These injuries are critical (category II) in severity.

The missile launch tube and battery can cause deep tissue bruising and fractures if they strike the forearm or hands. The remaining debris items will produce bruising and superficial lacerations if they strike areas of the body protected only by the BDU. These injuries are marginal (category III) in severity.

References

- Barach, E., Tomlanovich, M., and Nowak, R. 1986. Ballistics: A pathophysiologic examination of the wounding mechanisms of firearms: Part 1. Journal of Trauma. 26:3. 225-235.
- Department of Defense. 1984. System safety program requirements. Washington, D.C. MIL-STD-882D. March.
- Fackler, M. L. 1987. Wounds and injuries of the soft tissues. San Francisco, CA: Letterman Army Institute of Research. Institute Report 232.
- Gordon, C. A., Bradtmiller, B. Churchill, T., Clauser, C.E., McConville, J.T., Tebbetts, I., and Walker, R.A. 1989. 1988 anthropometric survey of U.S. Army personnel: methods and summary statistics. Natick, MA: Natick Research, Development, and Engineering Center. Natick/TR-89/044.
- Grolier Electronic Publishing. 1992. Grolier Multimedia Encyclopedia. Danbury, CT.
- Mendelson, J. A. 1991. The relationship between mechanisms of wounding and principles of treatment of missile wounds. Journal of Trauma. 31:9. 1181-1202.
- Texas Instruments. 1992. Technical data document for the Javelin antitank weapon system, revision D. Lewisville, TX: Texas Instruments. DT-0023D.

Initial distribution

Commander, U.S. Army Natick Research,
Development and Engineering Center
ATTN: SATNC-MIL (Documents
Librarian)
Natick, MA 01760-5040

U.S. Army Communications-Electronics
Command
ATTN: AMSEL-RD-ESA-D
Fort Monmouth, NJ 07703

Commander/Director
U.S. Army Combat Surveillance
and Target Acquisition Lab
ATTN: DELCS-D
Fort Monmouth, NJ 07703-5304

Commander
10th Medical Laboratory
ATTN: Audiologist
APO New York 09180

Naval Air Development Center
Technical Information Division
Technical Support Detachment
Warminster, PA 18974

Commanding Officer, Naval Medical
Research and Development Command
National Naval Medical Center
Bethesda, MD 20814-5044

Deputy Director, Defense Research
and Engineering
ATTN: Military Assistant
for Medical and Life Sciences
Washington, DC 20301-3080

Commander, U.S. Army Research
Institute of Environmental Medicine
Natick, MA 01760

Library
Naval Submarine Medical Research Lab
Box 900, Naval Sub Base
Groton, CT 06349-5900

Director, U.S. Army Human
Engineering Laboratory
ATTN: Technical Library
Aberdeen Proving Ground, MD 21005

Commander
Man-Machine Integration System
Code 602
Naval Air Development Center
Warminster, PA 18974

Commander
Naval Air Development Center
ATTN: Code 602-B (Mr. Brindle)
Warminster, PA 18974

Commanding Officer
Armstrong Laboratory
Wright-Patterson
Air Force Base, OH 45433-6573

Director
Army Audiology and Speech Center
Walter Reed Army Medical Center
Washington, DC 20307-5001

Commander, U.S. Army Institute
of Dental Research
ATTN: Jean A. Setterstrom, Ph. D.
Walter Reed Army Medical Center
Washington, DC 20307-5300

Commander, U.S. Army Test
and Evaluation Command
ATTN: AMSTE-AD-H
Aberdeen Proving Ground, MD 21005

Naval Air Systems Command
Technical Air Library 950D
Room 278, Jefferson Plaza II
Department of the Navy
Washington, DC 20361

Director
U.S. Army Ballistic
Research Laboratory
ATTN: DRXBR-OD-ST Tech Reports
Aberdeen Proving Ground, MD 21005

Commander
U.S. Army Medical Research
Institute of Chemical Defense
ATTN: SGRD-UV-AO
Aberdeen Proving Ground,
MD 21010-5425

Commander, U.S. Army Medical
Research and Development Command
ATTN: SGRD-RMS (Ms. Madigan)
Fort Detrick, Frederick, MD 21702-5012

Director
Walter Reed Army Institute of Research
Washington, DC 20307-5100

HQ DA (DASG-PSP-O)
5109 Leesburg Pike
Falls Church, VA 22041-3258

Harry Diamond Laboratories
ATTN: Technical Information Branch
2800 Powder Mill Road
Adelphi, MD 20783-1197

U.S. Army Materiel Systems
Analysis Agency
ATTN: AMXSY-PA (Reports Processing)
Aberdeen Proving Ground
MD 21005-5071

U.S. Army Ordnance Center
and School Library
Simpson Hall, Building 3071
Aberdeen Proving Ground, MD 21005

U.S. Army Environmental
Hygiene Agency
Building E2100
Aberdeen Proving Ground, MD 21010

Technical Library Chemical Research
and Development Center
Aberdeen Proving Ground, MD
21010-5423

Commander
U.S. Army Medical Research
Institute of Infectious Disease
SGRD-UIZ-C
Fort Detrick, Frederick, MD 21702

Director, Biological
Sciences Division
Office of Naval Research
600 North Quincy Street
Arlington, VA 22217

Commander
U.S. Army Materiel Command
ATTN: AMCDE-XS
5001 Eisenhower Avenue
Alexandria, VA 22333

Commandant
U.S. Army Aviation
Logistics School ATTN: ATSQ-TDN
Fort Eustis, VA 23604

Headquarters (ATMD)
U.S. Army Training
and Doctrine Command
ATTN: ATBO-M
Fort Monroe, VA 23651

Structures Laboratory Library
USARTL-AVSCOM
NASA Langley Research Center
Mail Stop 266
Hampton, VA 23665

Naval Aerospace Medical
Institute Library
Building 1953, Code 03L
Pensacola, FL 32508-5600

Command Surgeon
HQ USCENTCOM (CCSG)
U.S. Central Command
MacDill Air Force Base FL 33608

Air University Library
(AUL/LSE)
Maxwell Air Force Base, AL 36112

U.S. Air Force Institute
of Technology (AFIT/LDEE)
Building 640, Area B
Wright-Patterson
Air Force Base, OH 45433

Henry L. Taylor
Director, Institute of Aviation
University of Illinois-Willard Airport
Savoy, IL 61874

Chief, National Guard Bureau
ATTN: NGB-ARS (COL Urbauer)
Room 410, Park Center 4
4501 Ford Avenue
Alexandria, VA 22302-1451

Commander
U.S. Army Aviation Systems Command
ATTN: SGRD-UAX-AL (LTC Gillette)
4300 Goodfellow Blvd., Building 105
St. Louis, MO 63120

U.S. Army Aviation Systems Command
Library and Information Center Branch
ATTN: AMSAV-DIL
4300 Goodfellow Boulevard
St. Louis, MO 63120

Federal Aviation Administration
Civil Aeromedical Institute
Library AAM-400A
P.O. Box 25082
Oklahoma City, OK 73125

Commander
U.S. Army Academy
of Health Sciences
ATTN: Library
Fort Sam Houston, TX 78234

Commander
U.S. Army Institute of Surgical Research
ATTN: SGRD-USM (Jan Duke)
Fort Sam Houston, TX 78234-6200

AAMRL/HEX
Wright-Patterson
Air Force Base, OH 45433

John A. Dellinger,
Southwest Research Institute
P. O. Box 28510
San Antonio, TX 78284

Product Manager
Aviation Life Support Equipment
ATTN: AMCPM-ALSE
4300 Goodfellow Boulevard
St. Louis, MO 63120-1798

Commander
U.S. Army Aviation
Systems Command
ATTN: AMSAV-ED
4300 Goodfellow Boulevard
St. Louis, MO 63120

Commanding Officer
Naval Biodynamics Laboratory
P.O. Box 24907
New Orleans, LA 70189-0407

Assistant Commandant
U.S. Army Field Artillery School
ATTN: Morris Swott Technical Library
Fort Sill, OK 73503-0312

Commander
U.S. Army Health Services Command
ATTN: HSOP-SO
Fort Sam Houston, TX 78234-6000

U.S. Army Dugway Proving Ground
Technical Library, Building 5330
Dugway, UT 84022

U.S. Army Yuma Proving Ground
Technical Library
Yuma, AZ 85364

AFFTC Technical Library
6510 TW/TSTL
Edwards Air Force Base,
CA 93523-5000

Commander
Code 3431
Naval Weapons Center
China Lake, CA 93555

Aeromechanics Laboratory
U.S. Army Research and Technical Labs
Ames Research Center, M/S 215-1
Moffett Field, CA 94035

Sixth U.S. Army
ATTN: SMA
Presidio of San Francisco, CA 94129

Commander
U.S. Army Aeromedical Center
Fort Rucker, AL 36362

U.S. Air Force School
of Aerospace Medicine
Strughold Aeromedical Library Technical
Reports Section (TSKD)
Brooks Air Force Base, TX 78235-5301

Dr. Diane Damos
Department of Human Factors
ISSM, USC
Los Angeles, CA 90089-0021

U.S. Army White Sands
Missile Range
ATTN: STEWS-IM-ST
White Sands Missile Range, NM 88002

U.S. Army Aviation Engineering
Flight Activity
ATTN: SAVTE-M (Tech Lib) Stop 217
Edwards Air Force Base, CA 93523-5000

Ms. Sandra G. Hart
Ames Research Center
MS 262-3
Moffett Field, CA 94035

Commander, Letterman Army Institute
of Research
ATTN: Medical Research Library
Presidio of San Francisco, CA 94129

Commander
U.S. Army Medical Materiel
Development Activity
Fort Detrick, Frederick, MD 21702-5009

Commander
U.S. Army Aviation Center
Directorate of Combat Developments
Building 507
Fort Rucker, AL 36362

U. S. Army Research Institute
Aviation R&D Activity
ATTN: PERI-IR
Fort Rucker, AL 36362

Commander
U.S. Army Safety Center
Fort Rucker, AL 36362

U.S. Army Aircraft Development
Test Activity
ATTN: STEBG-MP-P
Cairns Army Air Field
Fort Rucker, AL 36362

Commander U.S. Army Medical Research
and Development Command
ATTN: SGRD-PLC (COL Schnakenberg)
Fort Detrick, Frederick, MD 21702

MAJ John Wilson
TRADOC Aviation LO
Embassy of the United States
APO New York 09777

Netherlands Army Liaison Office
Building 602
Fort Rucker, AL 36362

British Army Liaison Office
Building 602
Fort Rucker, AL 36362

Italian Army Liaison Office
Building 602
Fort Rucker, AL 36362

Directorate of Training Development
Building 502
Fort Rucker, AL 36362

Chief
USAHEL/USAAVNC Field Office
P. O. Box 716
Fort Rucker, AL 36362-5349

Commander U.S. Army Aviation Center
and Fort Rucker
ATTN: ATZO-CG
Fort Rucker, AL 36362

Chief
Test & Evaluation Coordinating Board
Cairns Army Air Field
Fort Rucker, AL 36362

MAJ Terry Newman
Canadian Army Liaison Office
Building 602
Fort Rucker, AL 36362

German Army Liaison Office
Building 602
Fort Rucker, AL 36362

LTC Patrice Cottebrune
French Army Liaison Office
USAAVNC (Building 602)
Fort Rucker, AL 36362-5021

Australian Army Liaison Office
Building 602
Fort Rucker, AL 36362

Dr. Garrison Rapmund
6 Burning Tree Court
Bethesda, MD 20817

Commandant, Royal Air Force
Institute of Aviation Medicine
Farnborough Hampshire GU14 6SZ UK

Commander
U.S. Army Biomedical Research
and Development Laboratory
ATTN: SGRD-UBZ-I
Fort Detrick, Frederick, MD 21702

Defense Technical Information
Cameron Station, Building 5
Alexandra, VA 22304-6145

Commander, U.S. Army Foreign Science
and Technology Center
AIFRTA (Davis)
220 7th Street, NE
Charlottesville, VA 22901-5396

Director,
Applied Technology Laboratory
USARTL-AVSCOM
ATTN: Library, Building 401
Fort Eustis, VA 23604

Commander, U.S. Air Force
Development Test Center
101 West D Avenue, Suite 117
Eglin Air Force Base, FL 32542-5495

Commander, U.S. Army Missile
Command
Redstone Scientific Information Center
ATTN: AMSMI-RD-CS-R
/ILL Documents
Redstone Arsenal, AL 35898

Dr. H. Dix Christensen
Bio-Medical Science Building, Room 753
Post Office Box 26901
Oklahoma City, OK 73190

Director
Army Personnel Research Establishment
Farnborough, Hants GU14 6SZ UK

U.S. Army Research and Technology
Laboratories (AVSCOM)
Propulsion Laboratory MS 302-2
NASA Lewis Research Center
Cleveland, OH 44135

Col. Otto Schramm Filho
c/o Brazilian Army Commission
Office-CEBW
4632 Wisconsin Avenue NW
Washington, DC 20016

Dr. Eugene S. Channing
7985 Schooner Court
Frederick, MD 21701-3273

LTC Gaylord Lindsey (5)
USAMRDC Liaison at Academy
of Health Sciences
ATTN: HSHA-ZAC-F
Fort Sam Houston, TX 78234

Aviation Medicine Clinic
TMC #22, SAAF
Fort Bragg, NC 28305

Dr. A. Kornfield, President
Biosearch Company
3016 Revere Road
Drexel Hill, PA 29026

NVEOD
AMSEI -RD-ASID
(Attn: Trang Bui)
Fort Belvoir, VA 22060

CA Av Med
HQ DAAC
Middle Wallop
Stockbridge Hants S020 8DY UK

Commander and Director
USAE Waterways Experiment Station
ATTN: CEWES-IM-MI-R
Alfrieda S. Clark, CD Dept.
3909 Halls Ferry Road
Vicksburg, MS 39180-6199

Mr. Peter Seib
Human Engineering Crew Station
Box 266
Westland Helicopters Limited
Yeovil, Somerset BA202YB UK

Dr. Christine Schlichting
Behavioral Sciences Department
Box 900, NAVUBASE NLON
Groton, CT 06349-5900

COL C. Fred Tyner
U.S. Army Medical Research
& Development Command
SGRD-ZB
Fort Detrick, Frederick, MD 21702-5012

COL John F. Glenn
U.S. Army Medical Research
& Development Command
SGRD-ZC
Fort Detrick, Frederick, MD 21702-5012